Title:	How to Upgrade Hybrid SAN Firmware to V234 (via web)	**Version:**	v1.0	**Date:**	04/29/2020
Product:	Hybrid SAN			**Page:**	1 of 4

Preparation

1. The status of Hybrid SAN must be Working

2. Support V232−6 and above versions to upgrade, Version below V232−6 please upgrade to V232-6 first

3. V234 Firmware
   Please check the capacity of each patch after you download from the FTP.



© Hangzhou Hikvision Digital Technology Co.,Ltd. All Rights Reserved.
No.555 Qianmo Road, Binjiang District, Hangzhou 310052, China • Tel: +86-571-8807-5998 • Fax: +1 909-595-0788
E-Mail: support@hikvision.com • www.hikvision.com

How to Upgrade Hybrid SAN Firmware to V234（via web）

1. Upgrade 1storos-201705091035-C_CVR231-4_CVR232-6-hk9000server316-9_add_upgradeserver-91X

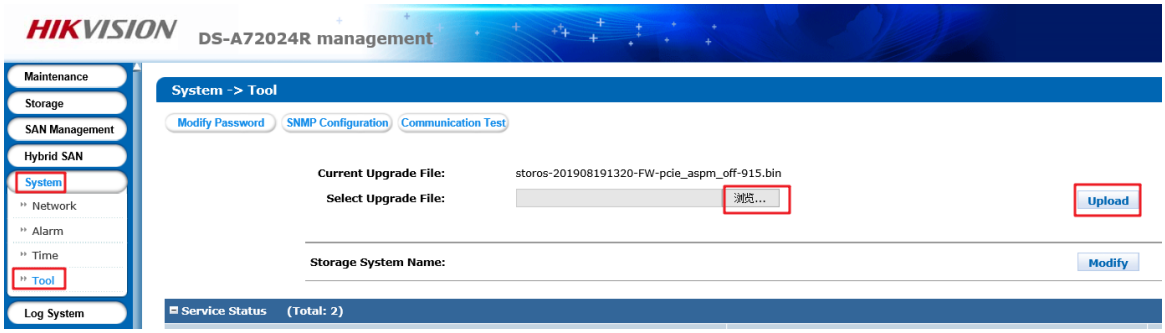

2. Upgrade 2storos-201606141705-B_OS-BiosSize-915

Note:

Please wait several minutes until it shows below tips

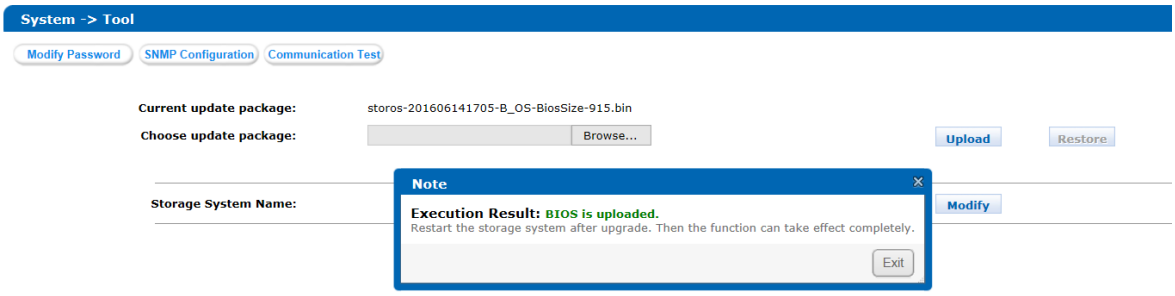

3. Reboot

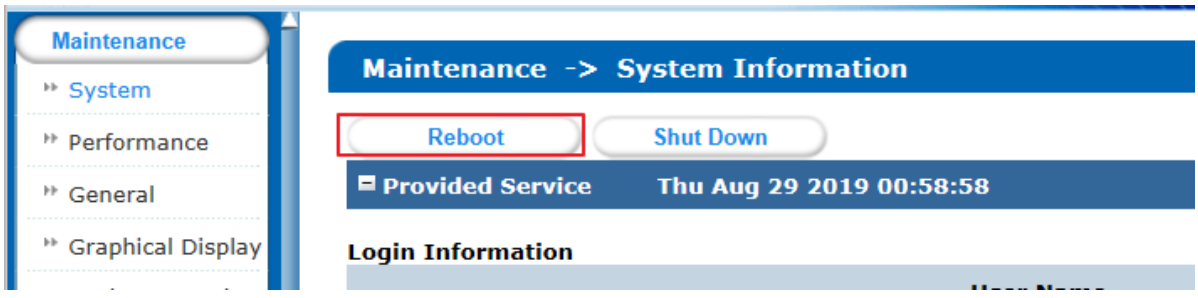

© Hangzhou Hikvision Digital Technology Co.,Ltd. All Rights Reserved.
No.555 Qianmo Road, Binjiang District, Hangzhou 310052, China • Tel: +86-571-8807-5998 • Fax: +1 909-595-0788
E-Mail: support@hikvision.com • www.hikvision.com

4. Upgrade 3storos-201711290824-Multi-CVR-V2.3.4_FW_OS_CVR-STD-COSTOM-suse_x64-91X

Note:

Please wait 3 minutes after it shows below tips

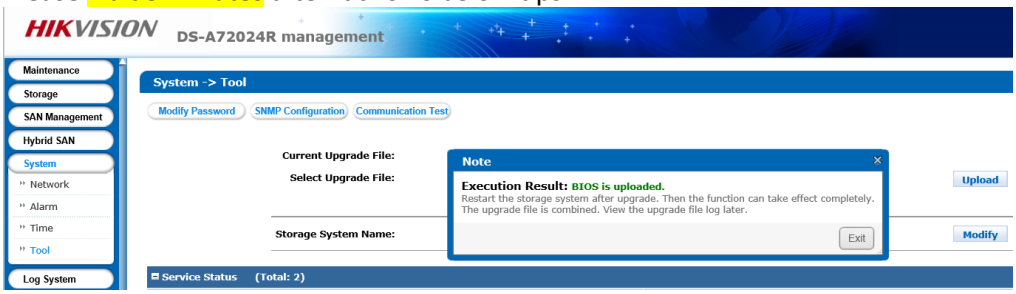

5. Reboot

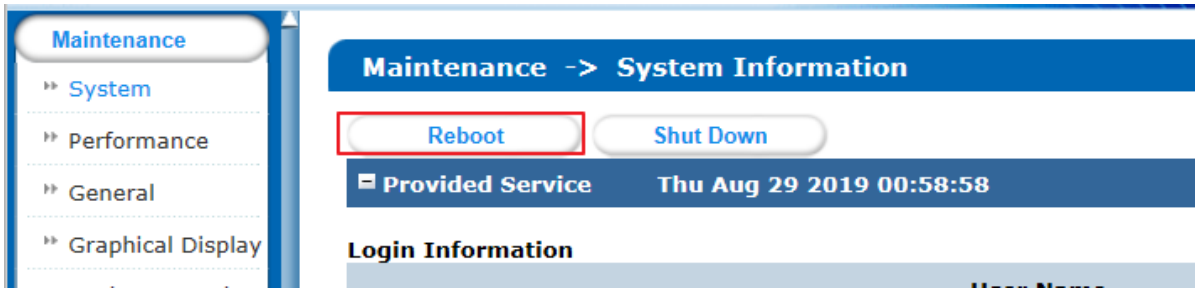

6. Upgrade 4storos-201409291645-naz_db_init_CVR_V231-suse_x64-91X

7. Reboot

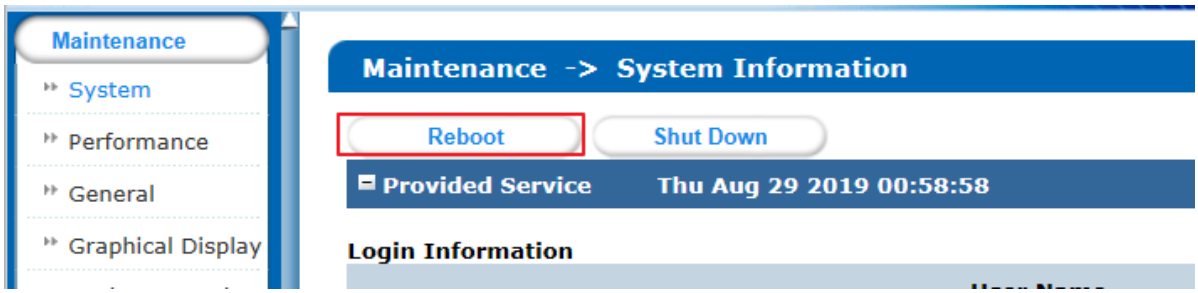

First Choice for Security Professionals

***HIKVISION* Technical Support**

© Hangzhou Hikvision Digital Technology Co.,Ltd. All Rights Reserved.

No.555 Qianmo Road, Binjiang District, Hangzhou 310052, China • Tel: +86-571-8807-5998 • Fax: +1 909-595-0788
E-Mail: support@hikvision.com • www.hikvision.com

© Hangzhou Hikvision Digital Technology Co.,Ltd. All Rights Reserved.
No.555 Qianmo Road, Binjiang District, Hangzhou 310052, China • Tel: +86-571-8807-5998 • Fax: +1 909-595-0788
E-Mail: support@hikvision.com • www.hikvision.com